



Aufsteckfräser 90° / LN.. 10  
Face milling cutter 90° / LN.. 10

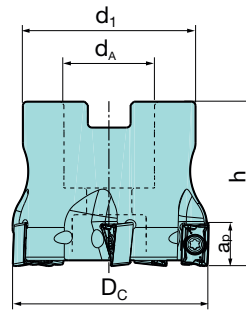

Abmessungen [mm] Dimensions [mm]						Artikelbezeichnung Item Code	Bestell-Nr. Order No	Verfüg. Availability	Ersatzteile Spare parts	
DC	dA	d1	aP	h	z					
40	16	35	9	40	4	HMF90 LN10.040 Z04	2236400	•	Spann- schraube Fastening screw HK02-41187 5001500 MA = 2Nm	Torx- Schlüssel Torque wrench T9 5000300
40	16	35	9	40	5	HMF90 LN10.040 Z05	2236500	•		
50	22	42	9	40	5	HMF90 LN10.050 Z05	2236600	•		
50	22	42	9	40	7	HMF90 LN10.050 Z07	2236700	•		
63	22	49	9	40	6	HMF90 LN10.063 Z06	2236800	•		
63	22	49	9	40	8	HMF90 LN10.063 Z08	2236900	•		

Schafffräser 90° / LN.. 10  
End milling cutter 90° / LN.. 10

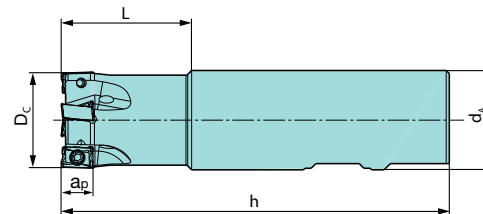

Abmessungen [mm] Dimensions [mm]						Artikelbezeichnung Item Code	Schaft Shank	Bestell-Nr. Order No	Verfüg. Availability	Ersatzteile Spare parts	
DC	dA	h	aP	L	z						
20	20	100	9	30	2	HME90 LN10.020 Z02	SW	2208600	•	Spann- schraube Fastening screw HK02-41187 5001500 MA = 2Nm	Torx- Schlüssel Torque wrench T9 5000300
20	20	150	9	30	2	HME90 LN10.020 Z02-150	SS	2208700	•		
20	20	100	9	30	3	HME90 LN10.020 Z03	SW	2208800	•		
25	25	115	9	35	2	HME90 LN10.025 Z02	SW	2208900	•		
25	25	150	9	35	2	HME90 LN10.025 Z02-150	SS	2209000	•		
25	25	115	9	35	3	HME90 LN10.025 Z03	SW	2209100	•		
32	32	125	9	42	3	HME90 LN10.032 Z03	SW	2209200	•		
32	32	180	9	42	3	HME90 LN10.032 Z03-180	SS	2209300	•		
32	32	125	9	42	4	HME90 LN10.032 Z04	SW	2209400	•		
40	32	130	9	42	4	HME90 LN10.040 Z04	SW	2209500	•		
40	32	130	9	42	5	HME90 LN10.040 Z05	SW	2209600	•		