

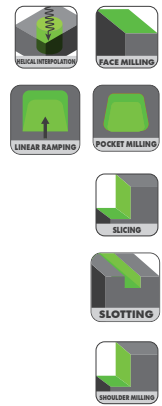
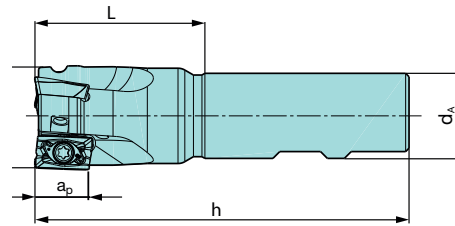


Schafffräser 90° / AP.. 10

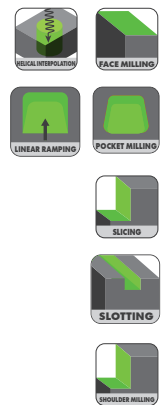

Abmessungen [mm] Dimensions [mm]						Artikelbezeichnung Item Code	Schaft Shank	Bestell-Nr. Order No	Verfüg. Availability	Ersatzteile Spare parts	
D _C	d _A	h	a _p	L	z						
12	16	80	9	32	1	HME90 AP10.012 Z01	SW	2205900	•	Spannschraube Fastening screw HKE17-36166 5004300 MA = 2Nm	Torx-Schlüssel Torque wrench IP8 5000800
12	16	120	9	32	1	HME90 AP10.012 Z01-120	SS	2206000	•		
16	16	85	9	37	2	HME90 AP10.016 Z02	SW	2206100	•		
16	16	130	9	37	2	HME90 AP10.016 Z02-130	SS	2206200	•		
20	20	90	9	40	3	HME90 AP10.020 Z03	SW	2206300	•		
20	20	150	9	40	3	HME90 AP10.020 Z03-150	SS	2206400	•		
25	25	105	9	49	4	HME90 AP10.025 Z04	SW	2206500	•		
25	25	170	9	49	4	HME90 AP10.025 Z04-170	SS	2206600	•		
32	25	110	9	54	5	HME90 AP10.032 Z05	SW	2206700	•		
32	25	195	9	54	5	HME90 AP10.032 Z05-195	SS	2206800	•		

Schafffräser 90° / AP.. 10 / INCH
End milling cutter 90° / AP.. 10 / INCH

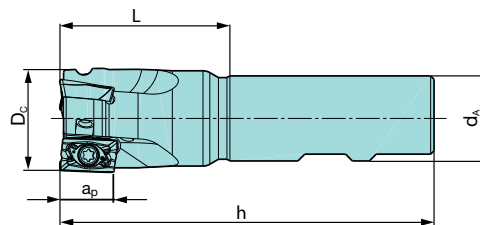

Abmessungen [INCH] Dimensions [INCH]						Artikelbezeichnung Item Code	Schaft Shank	Bestell-Nr. Order No	Verfüg. Availability	Ersatzteile Spare parts	
D _C	d _A	h	a _p	L	z						
0.500	0.625	3.250	0.354	1.250	1	HMEU90 AP10.0500 Z01	SW	2216400	○	Spannschraube Fastening screw HKE17-36166 5004300 MA = 2Nm	Torx-Schlüssel Torque wrench IP8 5000800
0.625	0.625	3.250	0.354	1.375	2	HMEU90 AP10.0625 Z02	SW	2216500	○		
0.750	0.750	3.375	0.354	1.500	3	HMEU90 AP10.0750 Z03	SW	2216600	○		
1.000	1.000	4.000	0.354	2.000	4	HMEU90 AP10.1000 Z04	SW	2216700	○		
1.250	1.000	4.000	0.354	2.000	5	HMEU90 AP10.1250 Z05	SW	2216800	○		